

INTERNATIONAL STANDARD

ISO 2808

Fourth edition
2007-02-01

Paints and varnishes — Determination of film thickness

Peintures et vernis — Détermination de l'épaisseur du feuil



Reference number
ISO 2808:2007(E)

PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

© ISO 2007

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.org
Web www.iso.org

Published in Switzerland

Contents

Page

Foreword.....	v
Introduction	vi
1 Scope	1
2 Normative references	1
3 Terms and definitions.....	1
4 Determination of wet-film thickness	3
4.1 General.....	3
4.2 Mechanical methods.....	3
4.2.1 Principle	3
4.2.2 Field of application	3
4.2.3 General.....	3
4.2.4 Method 1A — Comb gauge	4
4.2.5 Method 1B — Wheel gauge.....	5
4.2.6 Method 1C — Dial gauge.....	6
4.3 Gravimetric method.....	7
4.3.1 Principle	7
4.3.2 Field of application	7
4.3.3 General.....	7
4.3.4 Method 2 — By difference in mass	7
4.4 Photothermal method.....	8
4.4.1 Principle	8
4.4.2 Field of application	8
4.4.3 General.....	9
4.4.4 Method 3 — Determination using thermal properties.....	9
5 Determination of dry-film thickness	9
5.1 General.....	9
5.2 Mechanical methods.....	9
5.2.1 Principle	9
5.2.2 Field of application	10
5.2.3 General.....	10
5.2.4 Method 4A — By difference in thickness	11
5.2.5 Method 4B — Depth gauging.....	13
5.2.6 Method 4C — Surface profile scanning.....	15
5.3 Gravimetric method.....	16
5.3.1 Principle	16
5.3.2 Field of application	16
5.3.3 General.....	16
5.3.4 Method 5 — By difference in mass	16
5.4 Optical methods.....	17
5.4.1 Principle	17
5.4.2 Field of application	18
5.4.3 General.....	18
5.4.4 Method 6A — Cross-sectioning	19
5.4.5 Method 6B — Wedge cut.....	20
5.5 Magnetic methods	20
5.5.1 General.....	20
5.5.2 Principle	20
5.5.3 Field of application	20
5.5.4 General.....	21

ISO 2808:2007(E)

5.5.5	Method 7A — Magnetic pull-off gauge	21
5.5.6	Method 7B — Magnetic-flux gauge	22
5.5.7	Method 7C — Magnetic-induction gauge	22
5.5.8	Method 7D — Eddy-current gauge	23
5.6	Radiological method	24
5.6.1	Principle	24
5.6.2	Field of application	24
5.6.3	General	24
5.6.4	Method 8 — Beta backscatter method	25
5.7	Photothermal method	25
5.7.1	Principle	25
5.7.2	Field of application	26
5.7.3	General	26
5.7.4	Method 9 — Determination using thermal properties	27
5.8	Acoustic method	27
5.8.1	Principle	27
5.8.2	Field of application	27
5.8.3	General	27
5.8.4	Method 10 — Ultrasonic thickness gauge	28
6	Determination of thickness of uncured powder layers	28
6.1	General	28
6.2	Gravimetric method	29
6.2.1	Principle	29
6.2.2	Field of application	29
6.2.3	General	29
6.2.4	Method 11 — By difference in mass	29
6.3	Magnetic methods	29
6.3.1	Principle	29
6.3.2	Field of application	29
6.3.3	General	30
6.3.4	Method 12A — Magnetic-induction gauge	30
6.3.5	Method 12B — Eddy-current gauge	31
6.4	Photothermal method	31
6.4.1	Principle	31
6.4.2	Field of application	31
6.4.3	General	31
6.4.4	Method 13 — Determination using thermal properties	31
7	Measurement of film thickness on rough surfaces	32
7.1	General	32
7.2	Apparatus and materials	33
7.3	Procedure	33
7.3.1	Verification	33
7.3.2	Measurement	33
7.3.3	Number of readings	33
8	Test report	33
Annex A (informative) Overview of methods		35
Bibliography		38

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 2808 was prepared by Technical Committee ISO/TC 35, *Paints and varnishes*, Subcommittee SC 9, *General test methods for paints and varnishes*.

This fourth edition cancels and replaces the third edition (ISO 2808:1997), which has been technically revised. The main changes are as follows:

- a) The structure of the standard has been changed into four main clauses:
 - 1) determination of wet-film thickness;
 - 2) determination of dry-film thickness;
 - 3) determination of the thickness of uncured powder layers; and
 - 4) measurement of film thickness on rough surfaces.
- b) Methods using photothermal, radiological and acoustic techniques have been added.
- c) The split-beam method has been deleted as such instruments are no longer manufactured.

Introduction

Measurement of film thickness depends on the following steps:

- a) calibration of the measurement instrument, typically performed by the manufacturer or by any qualified laboratory;
- b) verification of the instrument (an accuracy check performed by the user at regular intervals, typically before each series of measurements);
- c) subsequent adjustment, if necessary, of the instrument so that the thickness readings it gives match those of a specimen of known thickness. For a dry-film thickness gauge this would mean zeroing it on the uncoated surface, using devices of known thickness such as shims, or using a coated specimen of known film thickness;
- d) measurement.

Paints and varnishes — Determination of film thickness

1 Scope

This International Standard describes a number of methods that are applicable to the measurement of the thickness of coatings applied to a substrate. Methods for determining wet-film thickness, dry-film thickness and the film thickness of uncured powder layers are described. Reference is made to individual standards where these exist. Otherwise the method is described in detail.

An overview on the methods is given in Annex A, in which the field of application, existing standards and the precision are specified for the individual methods.

This International Standard also defines terms concerning the determination of film thickness.

2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 463, *Geometrical Product Specifications (GPS) — Dimensional measuring equipment — Design and metrological characteristics of mechanical dial gauges*

ISO 3611, *Micrometer callipers for external measurement*

ISO 4618:2006, *Paints and varnishes — Terms and definitions*

ISO 8503-1, *Preparation of steel substrates before application of paints and related products — Surface roughness characteristics of blast-cleaned steel substrates — Part 1: Specifications and definitions for ISO surface profile comparators for the assessment of abrasive blast-cleaned surfaces*

3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 4618 and the following apply.

3.1

substrate

surface to which a coating material is applied or is to be applied

[ISO 4618:2006]

3.2

coating

continuous layer formed from a single or multiple application of a coating material to a substrate

[ISO 4618:2006]

ISO 2808:2007(E)

- 3.3**
film thickness
distance between the surface of the film and the surface of the substrate
- 3.4**
wet-film thickness
thickness of a freshly applied wet coating material, measured immediately after application
- 3.5**
dry-film thickness
thickness of a coating remaining on the surface when the coating has hardened
- 3.6**
thickness of uncured powder layer
thickness of a freshly applied coating material in powder form, measured immediately after application and before stoving
- 3.7**
relevant surface area¹⁾
part of an article covered or to be covered by the coating and for which the coating is essential for serviceability and/or appearance
- 3.8**
test area¹⁾
representative part of the relevant surface area within which an agreed number of single measurements is made as a spot-check
- 3.9**
measurement area¹⁾
area over which a single measurement is made
- 3.10**
minimum local film thickness¹⁾
lowest value of the local film thickness found on the relevant surface area of a particular test specimen
- 3.11**
maximum local film thickness¹⁾
highest value of the local film thickness found on the relevant surface area of a particular test specimen
- 3.12**
mean film thickness¹⁾
arithmetic mean of all the individual dry-film thicknesses in the test area or the result of a gravimetric determination of the thickness
- 3.13**
calibration
controlled and documented process of measuring traceable calibration standards and verifying that the results are within the stated accuracy of the measurement instrument

NOTE Initial calibration is typically performed by the instrument manufacturer or by a qualified laboratory in a controlled environment using a documented process. This initial calibration will normally be verified by the user at regular intervals. The standards used in the calibration are such that the combined uncertainties of the resultant measurement are less than the stated accuracy of the instrument.

¹⁾ Measurement of this property is only required for the extended evaluation of film thickness measurements; see Clause 8 (test report), items k) and l).

3.14**verification**

accuracy check performed by the user using reference standards

3.15**reference standard**

specimen of known thickness against which a user can verify the accuracy of the measurement instrument

NOTE Reference standards may be coated thickness standards, or shims. If agreed to by the contracting parties, a part of the test specimen may be used as a thickness standard for a particular job.

3.16**adjustment**

act of aligning the measurement instrument's thickness readings to match those of a reference standard

NOTE Most electronic measurement instruments can be adjusted on a thickness standard or on a shim, where the thickness of the coating or of the shim is known.

3.17**accuracy**

consistency between a measured value and the true value of the thickness standard

4 Determination of wet-film thickness

4.1 General

Annex A gives an overview of the methods used for the determination of wet-film thickness.

4.2 Mechanical methods

4.2.1 Principle

In all mechanical methods the substrate surface is contacted by part of the measurement instrument through the coating, and the surface of the coating is contacted simultaneously (see Figure 1) or subsequently (see Figures 2 and 3) by another part of the instrument. The wet-film thickness is the height difference between these two points of contact, which can be read directly.

4.2.2 Field of application

The mechanical principle is suitable for all film-substrate combinations. The substrate has to be flat in at least one direction in the area where the measurement is conducted. Curvature of the surface in a single plane is permissible (e.g. internal or external surface of pipes).

4.2.3 General

Classification as a destructive or non-destructive method depends on:

- a) the rheological properties of the coating material;
- b) the nature of the wetting contact between the contact surfaces of the measurement instrument and the coating material;
- c) whether the thickness measurements will make the coating unsuitable for the purpose for which it is intended.

Since the possibility of pigment particles remaining between the gauge and the substrate cannot be excluded, all mechanical methods contain a systematic error: the film thickness displayed is smaller than the actual wet-film thickness by at least the mean diameter of the pigment particles.

ISO 2808:2007(E)

In the case of a wheel gauge (method 1B, see 4.2.5), the wheel has to be wetted by the coating material. If not, this represents a further source of systematic error which can result in exaggerated readings and is a function of:


- the surface tension and the rheological properties of the coating material;
- the material of the wheel gauge;
- the speed at which the wheel is turned.

4.2.4 Method 1A — Comb gauge

4.2.4.1 Description of instrument

A comb gauge is a flat plate made of a corrosion-resistant material with teeth along its edges (see Figure 1). The reference teeth at the corners of the plate define a baseline along which the inner teeth are arranged to give a graduated series of gaps. Each tooth is labelled with the assigned gap value.

With commercially available comb gauges the maximum thickness which can be measured is typically 2 000 µm and the smallest increment is typically 5 µm.

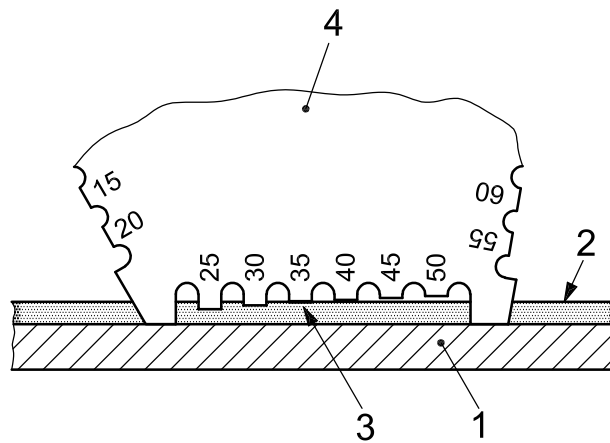

Key

- 1 substrate
- 2 coating
- 3 point of wetting contact
- 4 comb gauge

Figure 1 — Example of a comb gauge

4.2.4.2 Procedure

Ensure that the teeth are clean and not worn or damaged. Place the comb gauge onto the flat specimen surface such that the teeth are normal to the plane of the surface. Allow sufficient time for the coating to wet the teeth prior to removing the gauge.

In the case of specimens curved in a single plane, the comb gauge shall be placed in position parallel to the axis of curvature.

The result of the thickness measurement depends on the time of measurement. The thickness should therefore be measured as soon as possible after application.

Note the greatest gap reading of the tooth wetted by the coating material as the wet-film thickness.

4.2.5 Method 1B — Wheel gauge

4.2.5.1 Description of instrument

A wheel gauge consists of a wheel, made of hardened and corrosion-resistant steel, with three projecting rims (see Figure 2).


Two rims are ground to the same diameter and are configured concentrically to the wheel axle. The third rim has a smaller diameter and is eccentrically ground. One of the outer rims has a scale from which the respective projection of the concentric rims relative to the eccentric rim can be read.

Two versions are available:

- version 1 has the eccentric rim located between the concentric rims;
- version 2 has the eccentric rim located outside the concentric rims and closely adjacent to one of them.

NOTE Unlike version 1, the design of version 2 allows parallax-free reading of the wet-film thickness.

With commercially available wheel gauges, the maximum thickness which can be measured is typically 1 500 μm and the smallest increment is typically 2 μm .

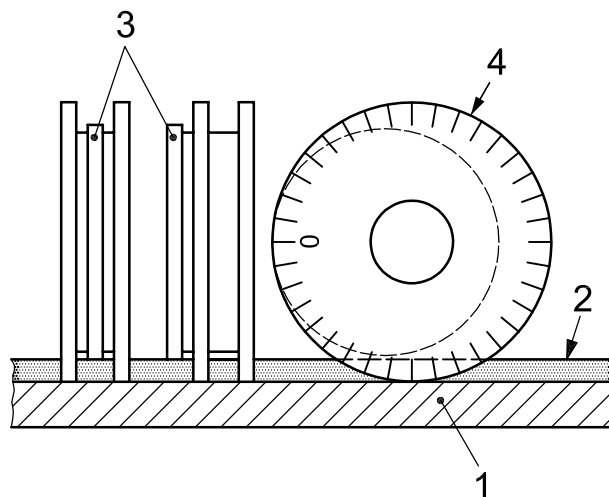

Key

- 1 substrate
- 2 coating
- 3 eccentric rim
- 4 wheel gauge

Figure 2 — Example of a wheel gauge

4.2.5.2 Procedure

Grip the wheel gauge with the thumb and index finger by the wheel axle and press the concentric rims onto the surface at the point of the largest reading on the scale.

In the case of specimens curved in a single plane, the axis of curvature and the wheel gauge axle shall be parallel.

Roll the wheel gauge in one direction, lift it from the surface and read off the highest scale reading at which the eccentric rim is still wetted by the coating material. Clean the gauge and repeat in the other direction.